



DESIGNER'S STATEMENT
 The escape of sediment from the site shall be prevented by the installation of erosion and sediment control measures and practice prior to, or concurrent with, land-disturbing activities.

APPROXIMATE CONSTRUCTION SCHEDULE


4/1/22 - 5/1/22	Install Erosion & Sediment Control
4/1/22 - 5/15/22	Perform Grading Operations
5/1/22 - 6/1/22	Install Temporary Vegetation
5/1/22 - 10/1/22	Site Work
3/1/23 - 4/1/23	Permanent Grassing
3/15/23 - 4/1/23	Remove Temporary Soil Control Device

BEST MANAGEMENT PRACTICES LEGEND

	Construction Exit
	Tree Protection Fencing
	Sediment Barrier Fencing
	Bf - Water Buffer

SOIL TYPES


CBA	Cecil Soil, 0-2%
CYB2	Cecil Sandy Loam, 2-6%
CYC2	Cecil Sandy Loam, 6-10%
PHC	Pacolet Gullied Land Complex, 6-10%
PFD2	Pacolet Sandy Loam, 10-15%
PGD3	Pacolet Sandy Clay Loam, 10-15%

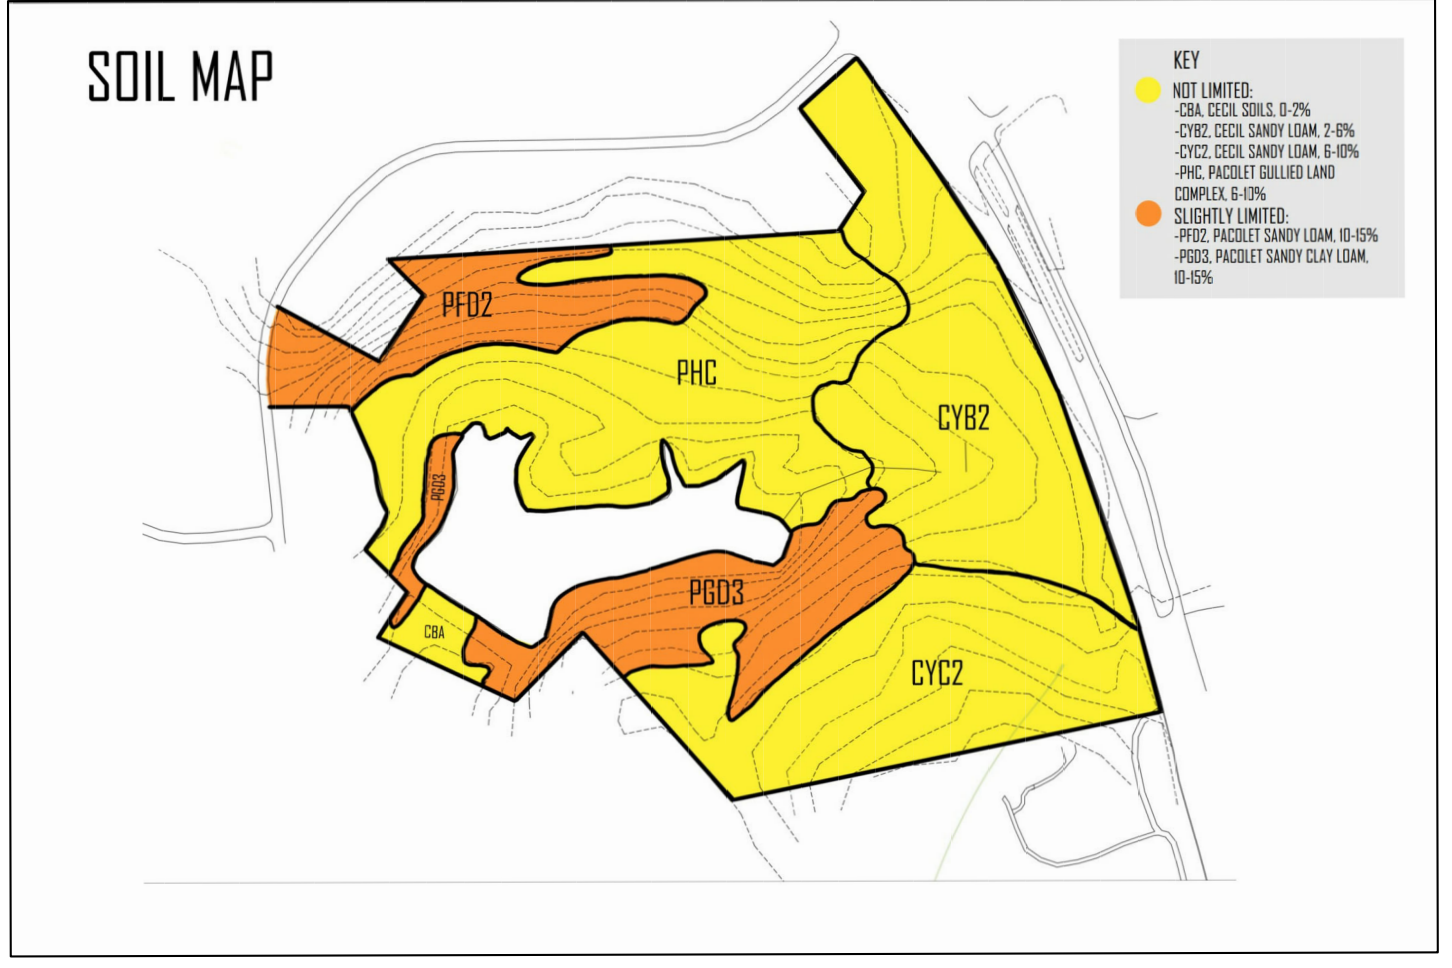

MOSS SITE CONSERVATION SUBDIVISION

EROSION AND SEDIMENT CONTROL PLANS

PHASE 1 PRECONSTRUCTION

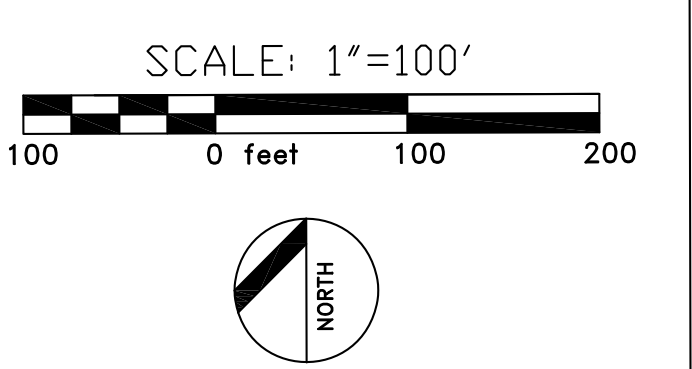




ERIKA ROSENZWEIG
 PROFESSOR
 NICHOLS
 LAND 3340

UNIVERSITY OF
 GEORGIA
 COLLEGE OF
 ENVIRONMENT AND
 DESIGN

24 HOUR CONTACT
 XXX-XXX-XXXX
 DESIGNER
 XXX-XXX-XXXX
 CONTRACTOR



BEST MANAGEMENT PRACTICES

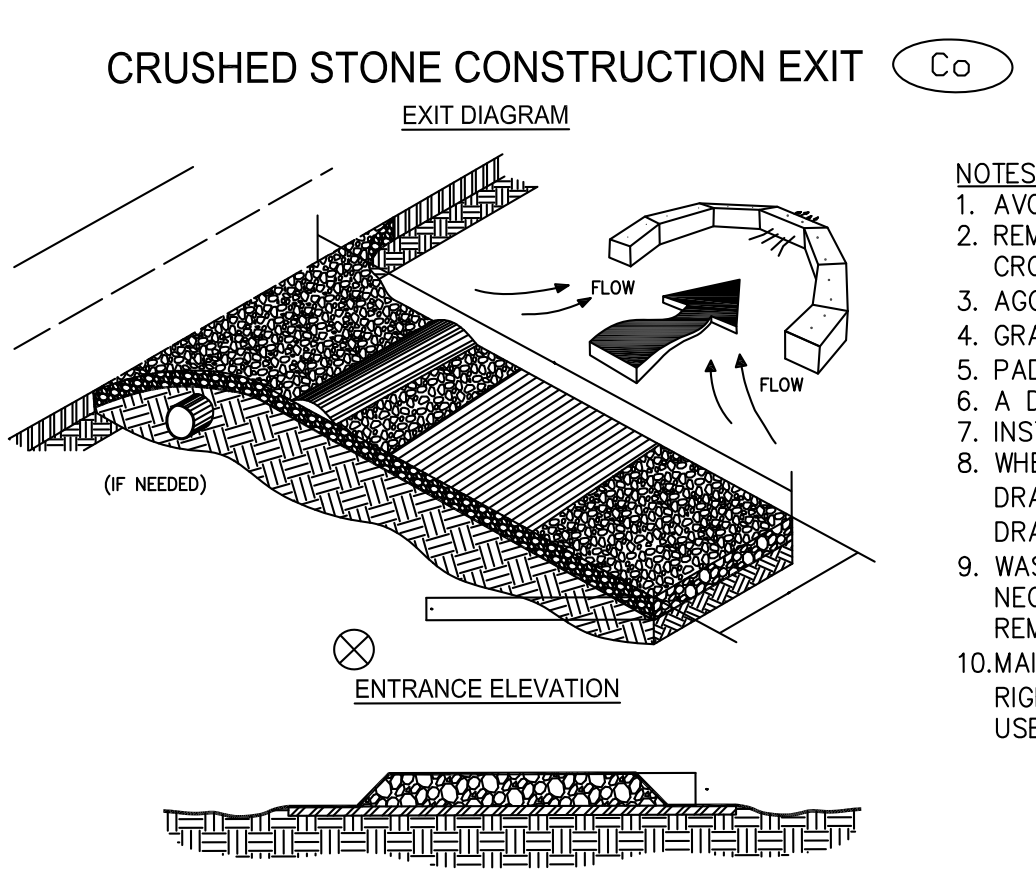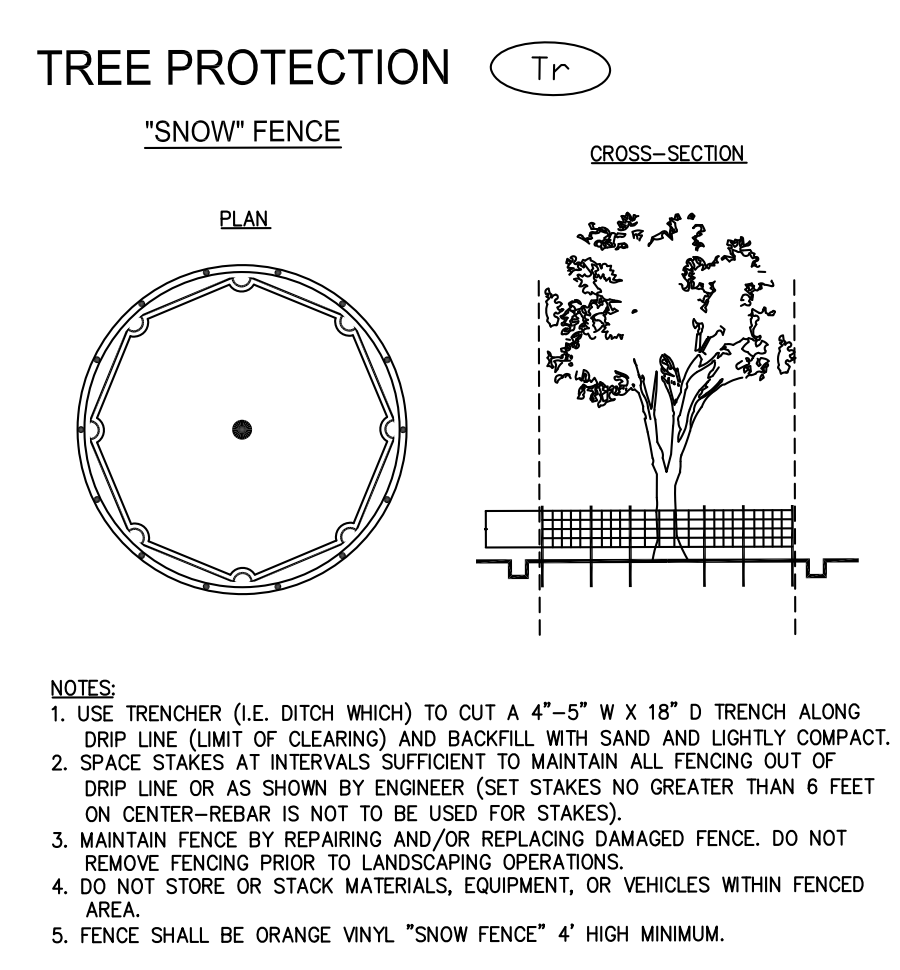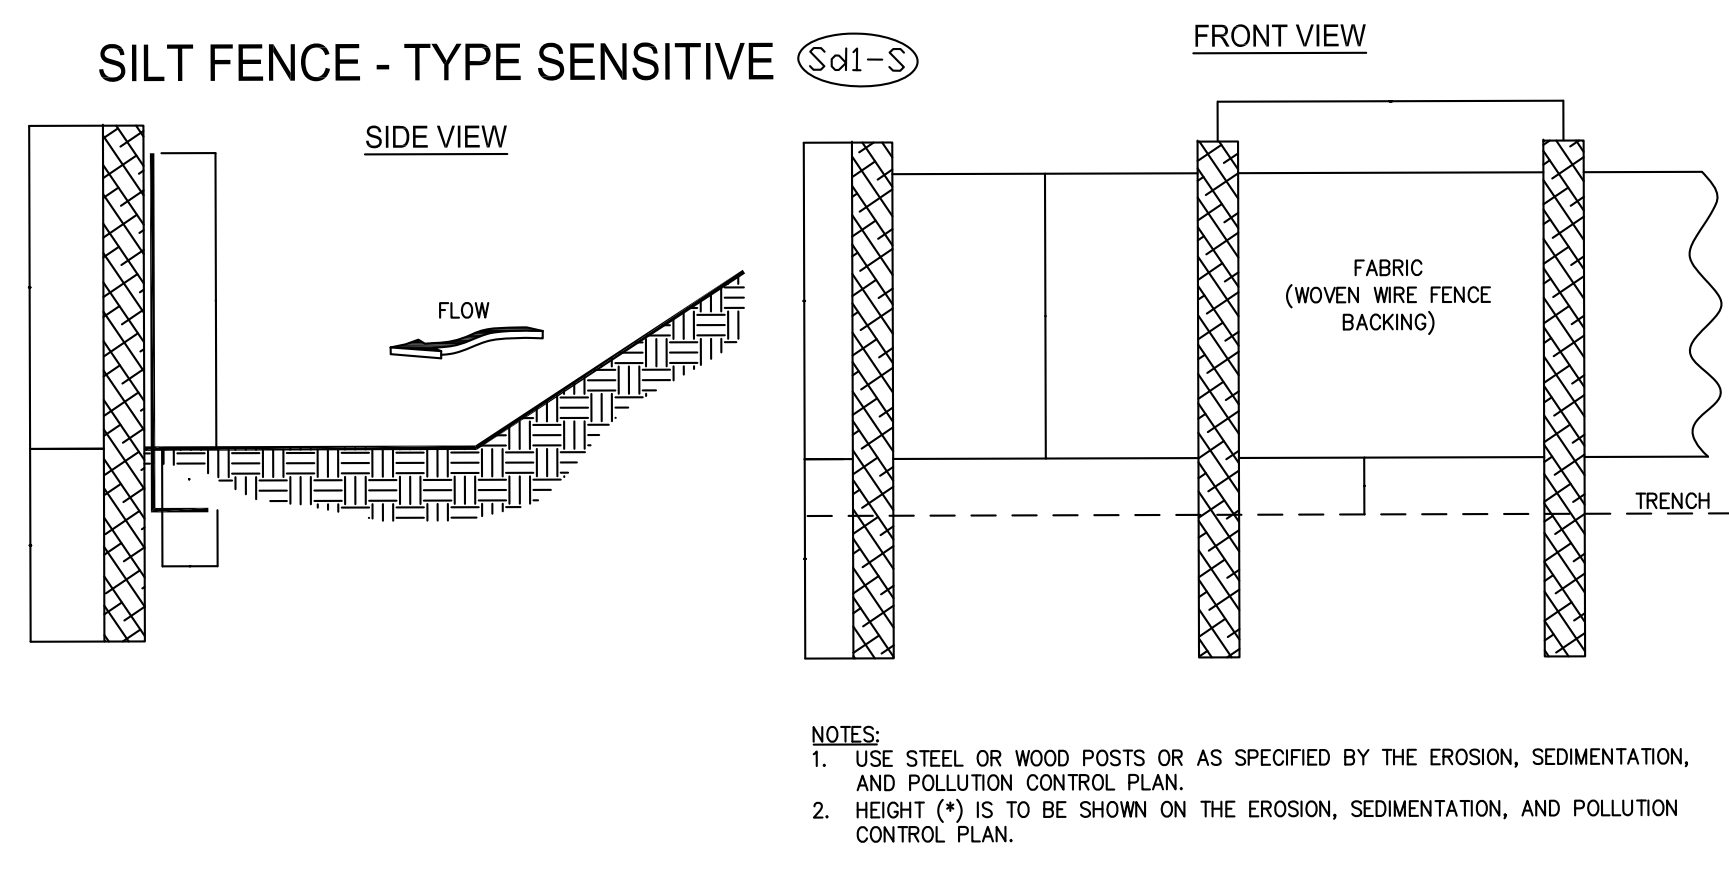

NOT TO SCALE

3/21/2022



DESIGNER'S STATEMENT
 The escape of sediment from the site shall be prevented by the installation of erosion and sediment control measures and practice prior to, or concurrent with, land-disturbing activities.

APPROXIMATE CONSTRUCTION SCHEDULE


4/1/22 - 5/1/22	Install Erosion & Sediment Control
4/1/22 - 5/15/22	Perform Grading Operations
5/1/22 - 6/1/22	Install Temporary Vegetation
5/1/22 - 10/1/22	Site Work
3/1/23 - 4/1/23	Permanent Grassing
3/15/23 - 4/1/23	Remove Temporary Soil Control Device

BEST MANAGEMENT PRACTICES LEGEND

(1-Sd4)	Temporary Sediment Trap
(Cd-Hb)	Hay Bale Check Dam
(Sr-C)	Temporary Culvert Crossing
[Hatched Area]	Wb - Water Buffer
[Dotted Area]	DS1 - Disturbed Area Stabilization

SOIL TYPES


CBA	Cecil Soil, 0-2%
CYB2	Cecil Sandy Loam, 2-6%
CYC2	Cecil Sandy Loam, 6-10%
PHC	Pacolet Gullied Land Complex, 6-10%
PFD2	Pacolet Sandy Loam, 10-15%
PGD3	Pacolet Sandy Clay Loam, 10-15%

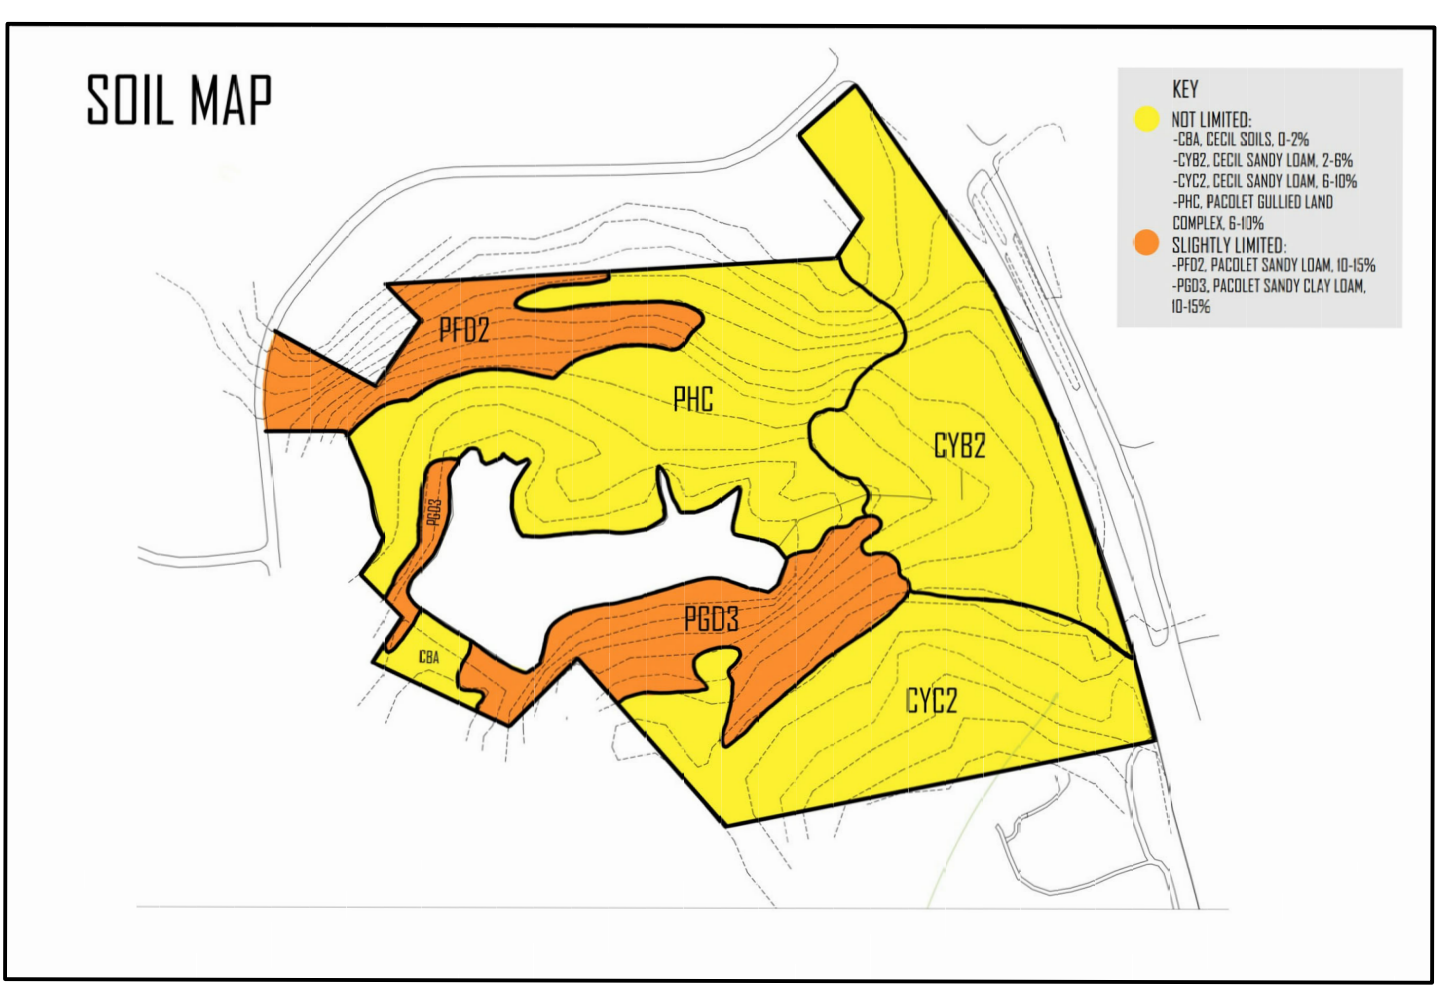

MOSS SITE
 CONSERVATION
 SUBDIVISION

EROSION AND
 SEDIMENT CONTROL
 PLANS

PHASE 2
 PRELIMINARY SITE
 GRADING

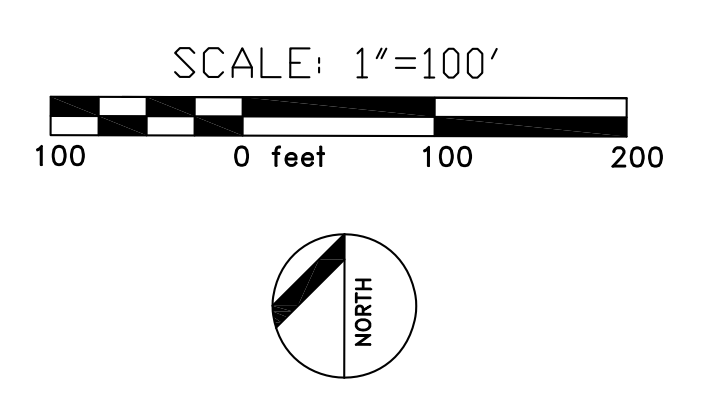

ERIKA ROSENZWEIG
 PROFESSOR
 NICHOLS
 LAND 3340

UNIVERSITY OF
 GEORGIA
 COLLEGE OF
 ENVIRONMENT AND
 DESIGN

24 HOUR CONTACT
 XXX-XXX-XXXX
 DESIGNER
 XXX-XXX-XXXX
 CONTRACTOR




3/21/2022


SHEET 2 OF 3

BEST MANAGEMENT PRACTICES


TYPICAL STRAW BALE CHECK DAM (Cd-Hb)

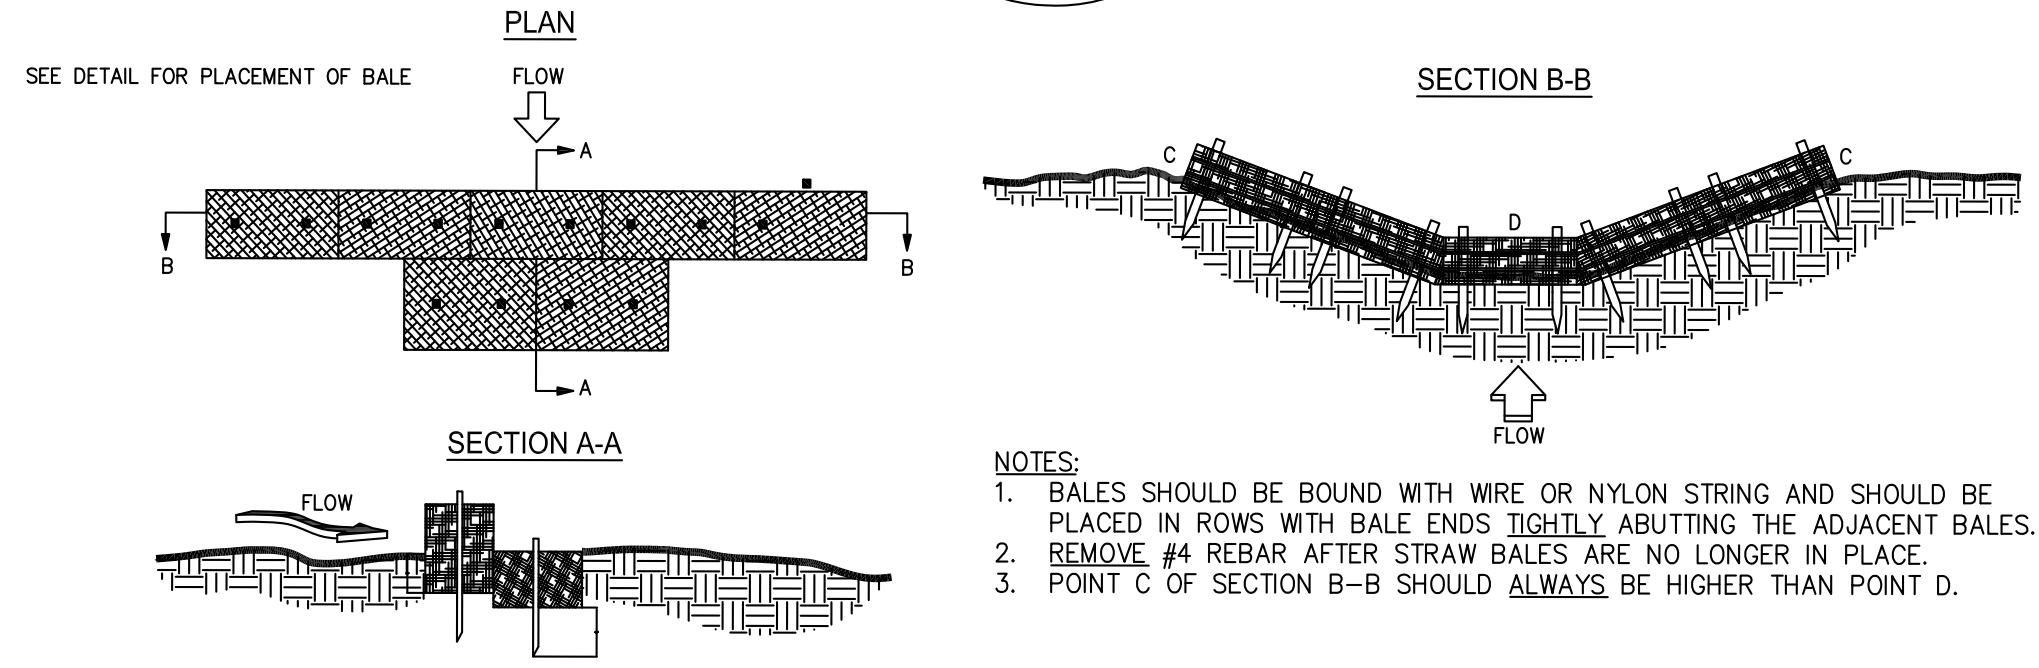


TEMPORARY SEDIMENT TRAP (Sd4-B)

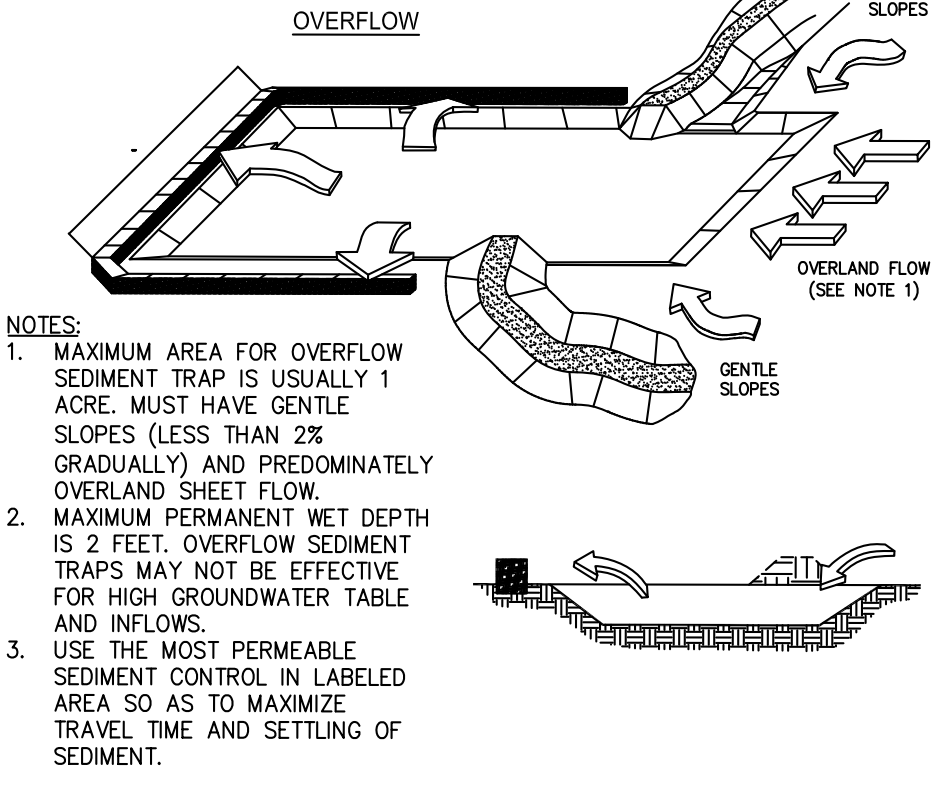

TEMPORARY STREAM CROSSING (Sr-C)

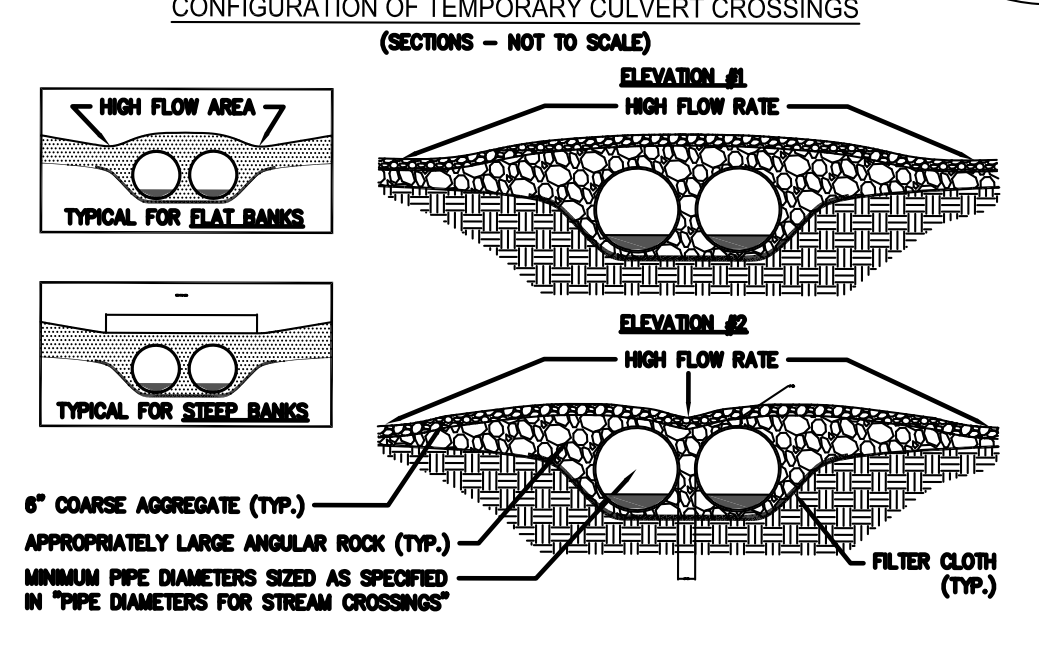

TYPICAL CULVERT CROSSING PLAN (NOT TO SCALE)

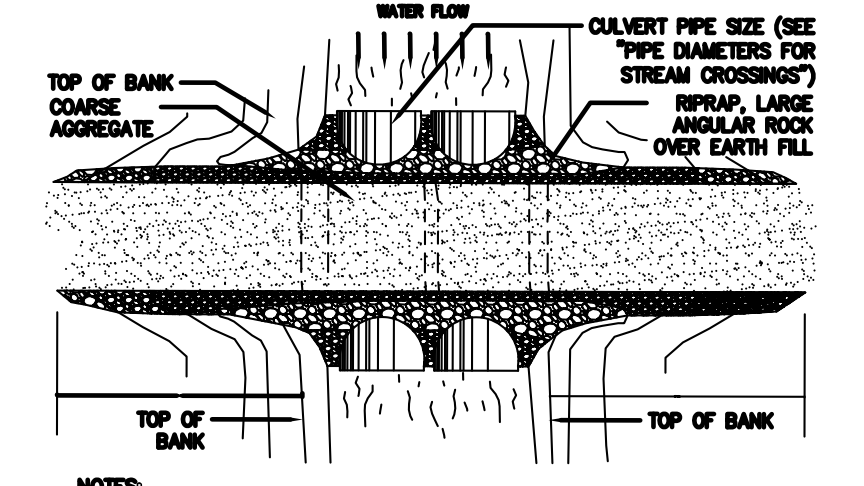

NOT TO SCALE



DESIGNER'S STATEMENT
 The escape of sediment from the site shall be prevented by the installation of erosion and sediment control measures and practice prior to, or concurrent with, land-disturbing activities.

APPROXIMATE CONSTRUCTION SCHEDULE


4/1/22 - 5/1/22	Install Erosion & Sediment Control
4/1/22 - 5/15/22	Perform Grading Operations
5/1/22 - 6/1/22	Install Temporary Vegetation
5/1/22 - 10/1/22	Site Work
3/1/23 - 4/1/23	Permanent Grassing
3/15/23 - 4/1/23	Remove Temporary Soil Control Device

BEST MANAGEMENT PRACTICES LEGEND

	Construction Exit
	Tree Protection Fencing
	Sediment Barrier Fencing
	Temporary Sediment Trap
	Hay Bale Check Dam
	Temporary Stream Crossing
	Wb - Water Buffer
	DS2 - Temporary Seeding

SOIL TYPES


CBA	Cecil Soil, 0-2%
CYB2	Cecil Sandy Loam, 2-6%
CYC2	Cecil Sandy Loam, 6-10%
PHC	Pacolet Gullied Land Complex, 6-10%
PGD2	Pacolet Sandy Loam, 10-15%
PGD3	Pacolet Sandy Clay Loam, 10-15%

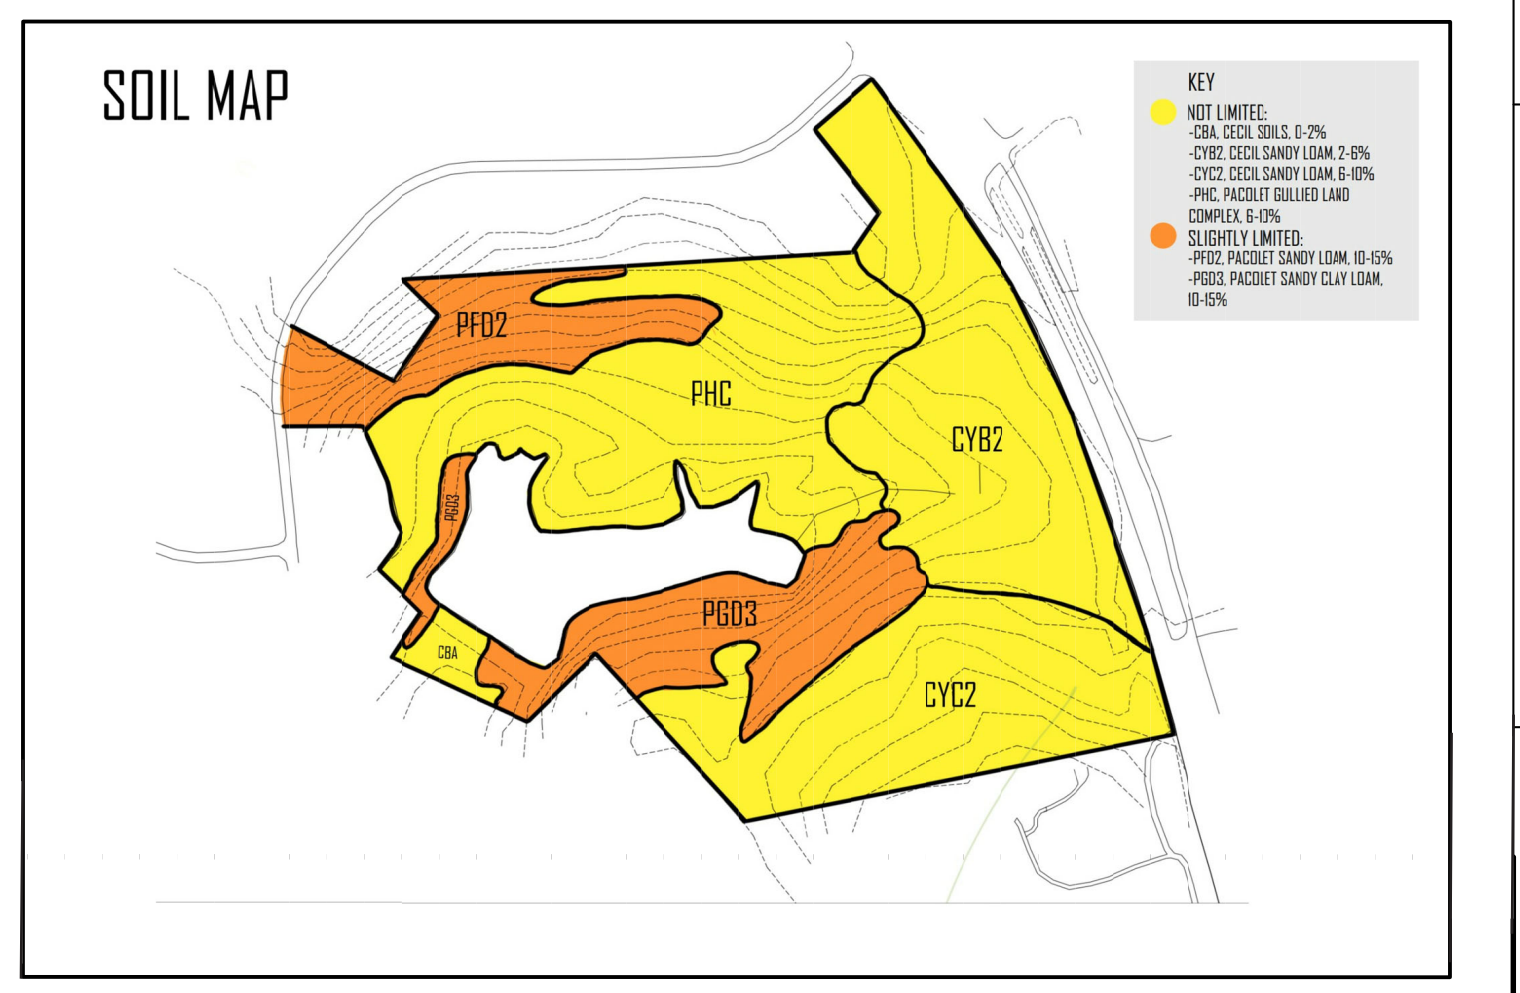

MOSS SITE
 CONSERVATION
 SUBDIVISION

EROSION AND
 SEDIMENT CONTROL
 PLANS

PHASE 3
 FINAL SITE
 GRADING PLAN

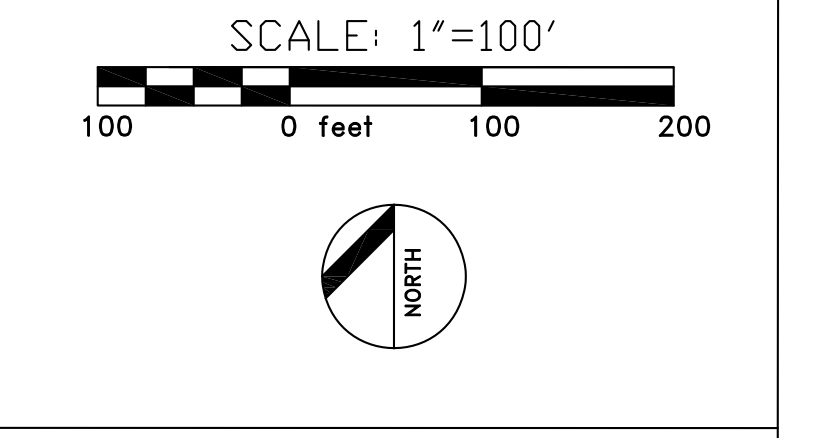





ERIKA ROSENZWEIG
 PROFESSOR
 NICHOLS
 LAND 3340

UNIVERSITY OF
 GEORGIA
 COLLEGE OF
 ENVIRONMENT AND
 DESIGN

24 HOUR CONTACT
 XXX-XXX-XXXX
 DESIGNER
 XXX-XXX-XXXX
 CONTRACTOR



BEST MANAGEMENT PRACTICES

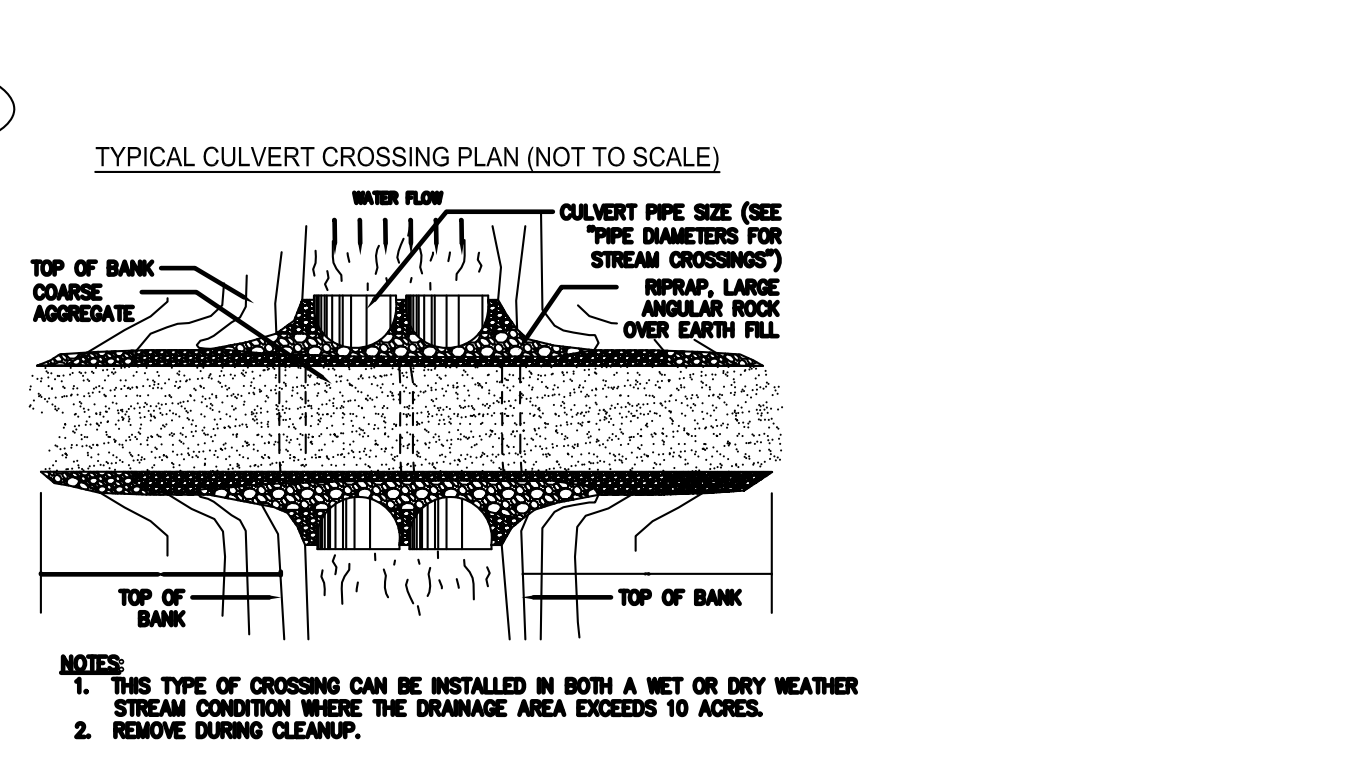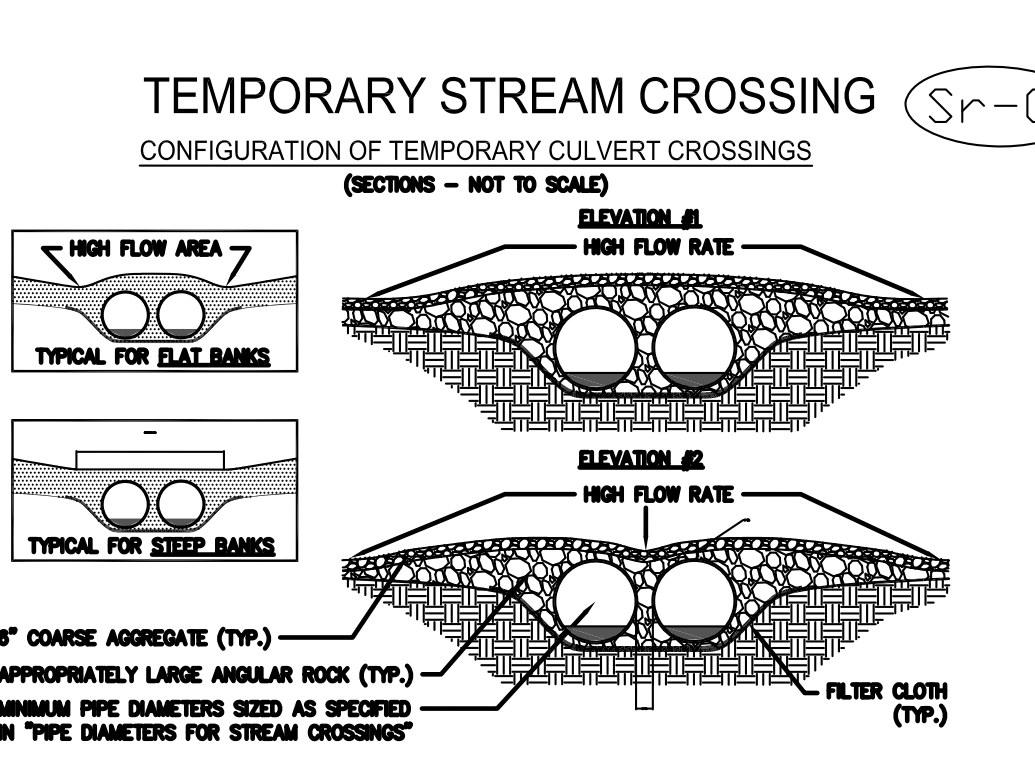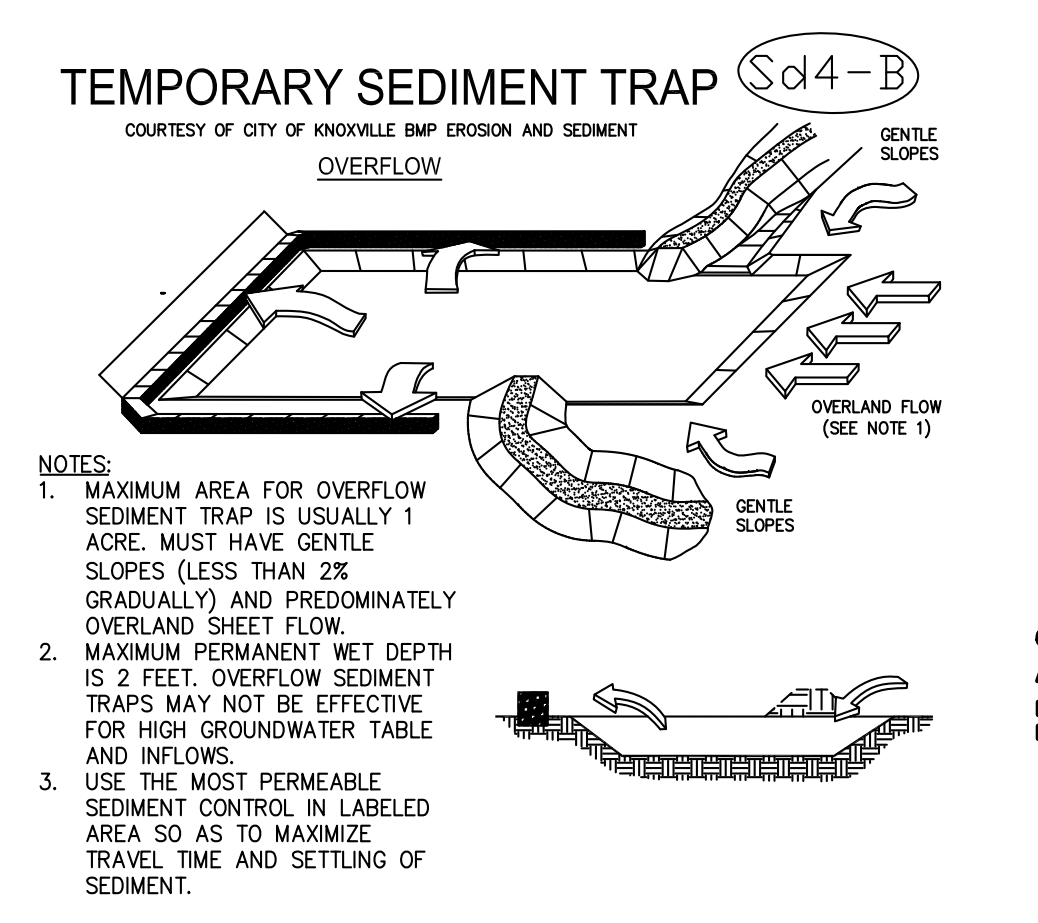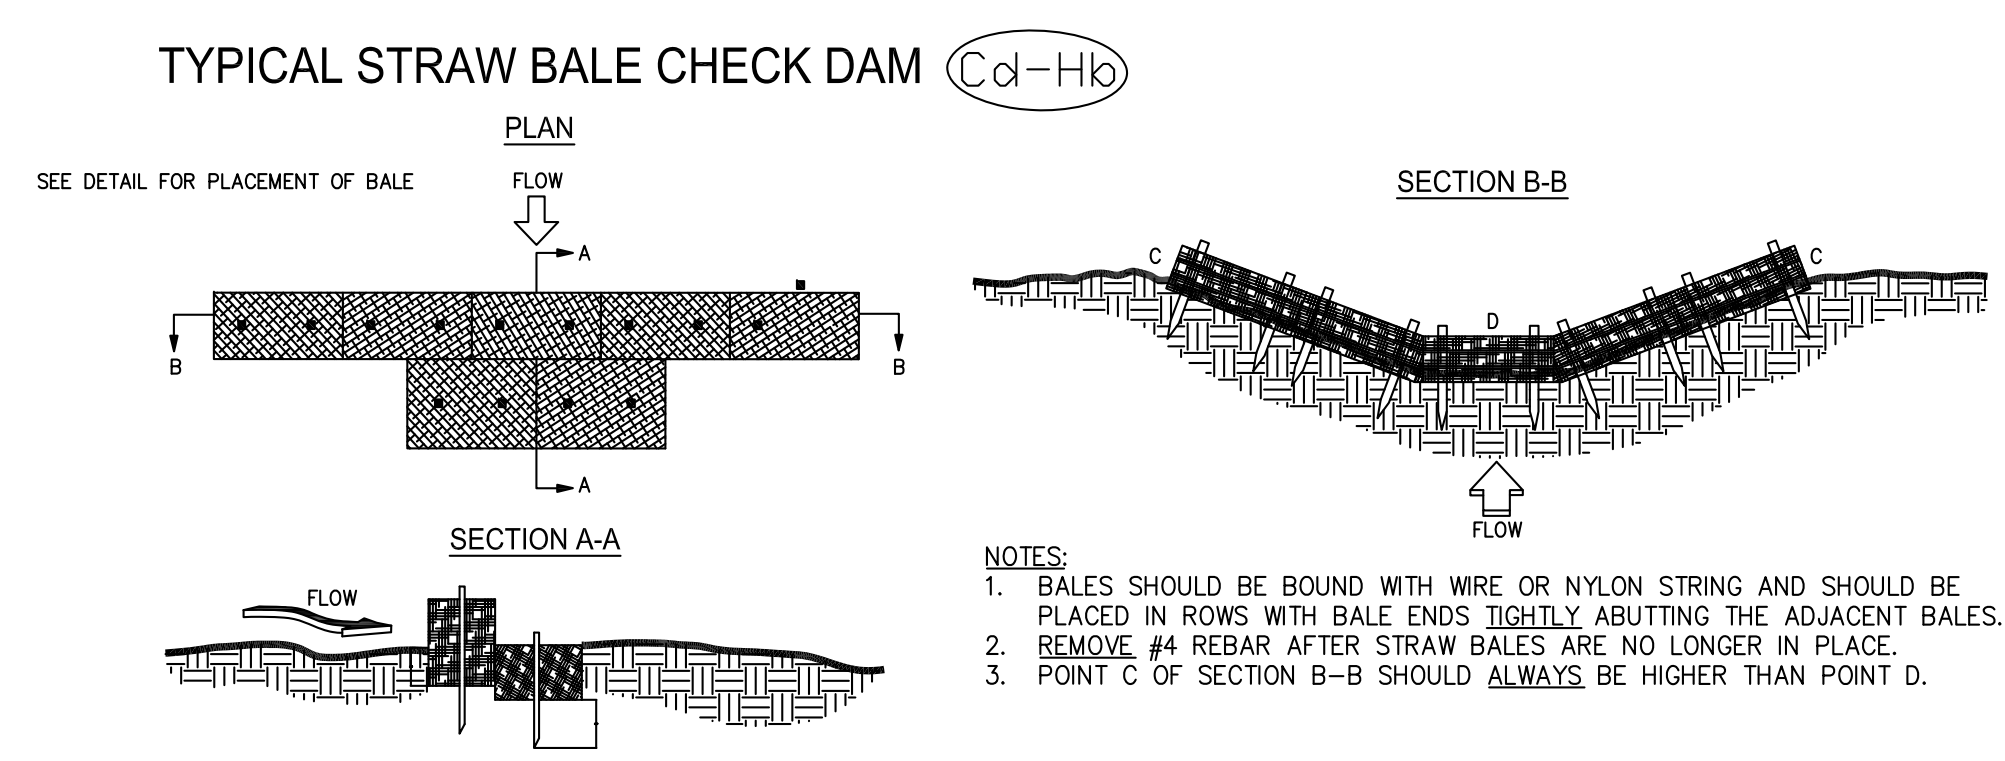

NOT TO SCALE

3/21/2022
 SHEET 3 OF 3